



Highland
RIDGE RV



Extending Heat Shield Instructions

Bulletin Type:	Recall	Publication Date:	June 2022
Bulletin #(s):	22V-297 US_2022-231 CAN	Make(s):	Jayco
Job Code(s):	9903576	Model(s):	Precept 31UL
Flat Rate(s):	9903576A - .10 Inspection 9903576B - .30 Inspection and Installation	Model Year(s):	2020-2022

Incident:	The storage compartment could melt because the heat shield is too small to protect it from the heat of the exhaust system beneath it.
Affected Units:	Certain 2020-2022 Jayco model 31UL Precepts
Parts Kit: 22V-297	Parts Kit #: 22V-297
	Parts Kit Contents: (1) PLENUM,HTSHL 16.00X33.00 16 GA STL (2036705) (1) SHIELD,HT 11.00X12.00X12.75 16GA GALV STL (2033003) (6) SCREW,PAN QUAD 10.00X1.00 TEK 3 BLK (0244409) (8) SCREW,PAN QUAD 8.00X .50 TEK (0711451)
Misc. Tools & Supplies:	Screwgun with Square Bit
Parts Return Information:	N/A

HEAT SHIELD INSPECTION

1. Inspect underneath the storage compartment for the extended heat shield located above the exhaust and next to the transmission. File for inspection only if the extended heat shield has been installed. Proceed to step 1 in the Instructions if the extended heat shield has not been installed.



INSTALLING HEAT SHIELD FOR STORAGE COMPARTMENT

⚠ CRITICAL SAFETY ITEM

1. If possible, pull vehicle onto a hoist and raise unit to a comfortable working height.

⚠ Prior to completing any additional installation, make sure the exhaust and engine are cool to avoid burning.

2. Slide the L-shaped heat shield above the exhaust and next to the transmission. (Fig. 1)
3. Align the edge of the heat shield with the chassis frame rail and the bottom of the mounting angle. Secure into angle with (3) TEK screws. (Fig. 2)

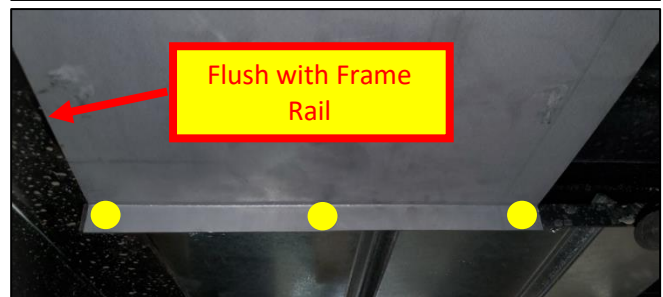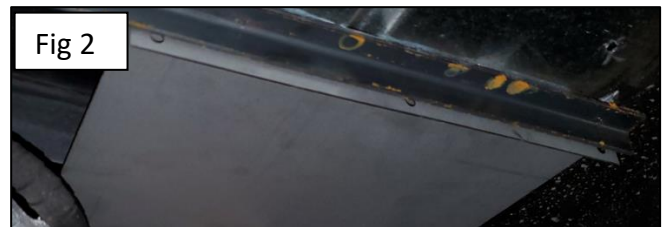

4. Align the top of the heat shield with the top of the mounting tube. Secure with (3) TEK screws. (Fig. 3)



5. Slide plenum heat shield above both drive shaft and exhaust. (Fig. 4)



- Align the edge of the heat shield with the chassis frame rail. Secure into angle with (4) TEK screws on each side flange. (Fig. 5)



Jayco's sole obligation under our limited warranty is to repair or replace defective materials and/or workmanship deemed our responsibility as determined by Jayco in our sole discretion. Jayco reserves the right to use new and/or remanufactured parts or materials of similar quality to complete any work, and to make parts and/or design changes as appropriate without notice to anyone. Jayco designs and/or materials changes are done without obligation to incorporate such changes in previously manufactured product. Jayco makes every reasonable effort to ensure field remedies will not adversely affect performance and/or safety of the unit. This field remedy is not intended to extend to future performance of this RV, or any of its materials, components or parts beyond the standard warranty period. The RV owner's obligation to notify Jayco, or one of its independent, authorized dealers, of a claimed defect does not modify any obligation placed on the RV owner to contact Jayco directly when attempting to pursue remedies under state or federal law.

903 South Main Street • P.O. Box 460 • Middlebury, IN 46540