

L624-
A.08.15

To: Official After Sales Network
Subject: Fr bottom panel replacement
Date: 03/13/2015
Pages: 1



Subject

Fr bottom panel replacement

Model

All Lamborghini Model Huracán MY 15 from VIN **FLA00163** to VIN **FLA00615**.

Warning: some vehicles included in this VIN range may not be involved, so check carefully on the Lamborghini WEB Portal (at the section named VIN Info) if the cars in your workshop or in your dealer stock are involved before performing any other operation.

Information to the field

As a result of continuous product monitoring, Automobili Lamborghini Spa has found that on some vehicles, the flap which is riveted on the front bottom panel can get loose, consequentially to impacts in manoeuvring.

Field solution

Replace panel with a new concept one.

Spare parts

P/N	Description	Q
4T0825101C	front bottom panel	1

Replaced parts management.

Store and tagged properly the parts replaced with bar code form for their identification during Area Manager visits.

Warranty Claim data

The warranty reimbursement request for this rework action will be managed by the following standard Warranty Claim procedures.

Campaign Code: L624-A.08.15
Campaign Des.: Fr bottom panel replacement.
Cost code: 50
Component code: CCA0815
Trouble code: 220
Labor code: CCA0815100
Labor Time: 0,2

Remember to fill all data in the section "Service and Recall Campaign" in the Warranty booklet of the vehicle as shown below.

Repair instructions




1. Remove front bottom panel

Jack properly car on a suitable lift with all precautions to work safe from risks.

Unscrew 36 fixing elements to remove old bottom panel.

Screw tightening.

Torque: **6 Nm (4,43 lbf ft) ± 20%**

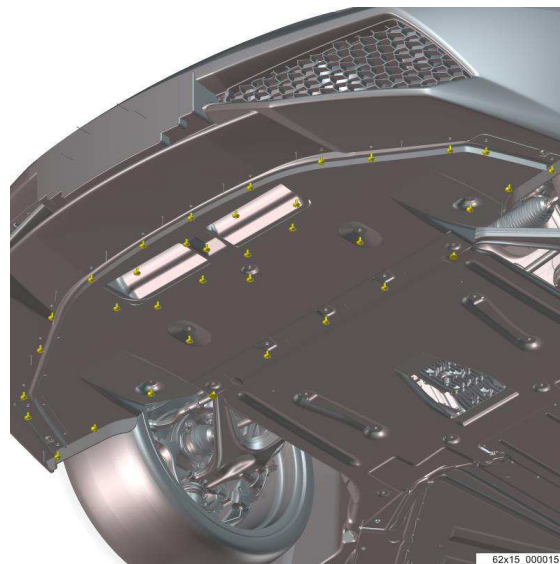

2. Replace old with new panel (P/N 4T0825101C).

Rev.01

The information and procedures published below are strictly confidential and intended exclusively for authorized operators and individuals. All copyrights are the property of Automobili Lamborghini S.p.A based on copyright law. The company reserves the right to make updates and modifications. The reprinting, reproduction, forwarding to unauthorized people and/or to third parties and partial or entire translation thereof are prohibited without written authorization from Automobili Lamborghini S.p.A.

doc. nr: L/V6_M06 Rev.[02]

1/1