



To All Lamborghini Dealers and Licensed Service Point  
From Customer Service Department  
Subject Engine and Gearbox ECU Software Update  
Group 10.01.00  
Date 12/10/2011  
Pages 25

**Subject**

Engine and Gearbox ECU software update

**Models/VINs involved:**

Aventador LP-700 MY12 from VIN 00091 to VIN 00175

Attention: please carefully check on the Lamborghini Web-portal to verify the VIN-Information and if the vehicle is affected by this Service Campaign before the start of any updating.

**Information to the field**

As a result of a continuous product monitoring, Automobili Lamborghini S.p.A. found that, in some cases, the drivability of the car and the clutch engagement comfort in start condition could be improved.

**Field solution**

Update the Engine and Gearbox control units

---

*The information and procedures published below are strictly confidential and intended exclusively for authorized operators and individuals. All copyrights are the property of Automobili Lamborghini S.p.A based on copyright law. The company reserves the right to make updates and modifications. The reprinting, reproduction, forwarding to unauthorized people and/or to third parties and partial or entire translation thereof are prohibited without written authorization from Automobili Lamborghini S.p.A.*



## Warranty Claim data

The warranty reimbursement request for this rework action will be managed by the following standard Warranty Claim procedures.

**Campaign Code:** L834-A.03.11  
**Campaign Description:** Engine and gearbox ECU software update  
**Cost Code:** 50  
**Component Code:** CCA0311  
**Trouble Code:** 220  
**Labour Code:** CCA0311100  
**Labour Time:** 1 hr

Remember to fill all data in the section “Service and Recall Campaign” in the Warranty booklet of the vehicle as shown below.

Automobili Lamborghini S.p.A.				LAMBORGHINI			
Campagne service assistenza e campagne di richiamo / Service-und Rückrufaktion / Service and Recall Campaign							
Service et campagne de rappel / Campaña de Servicio y Llamada a Taller							
Service/Service Servizio	<input type="checkbox"/>	Richiamo/Rückruf Recall/Rappel Llamada a Taller	<input type="checkbox"/>	Service/Service Servizio	<input type="checkbox"/>	Richiamo/Rückruf Recall/Rappel Llamada a Taller	<input type="checkbox"/>
Numero/Nummer Número	<input type="text"/>			Numero/Nummer Número	<input type="text"/>		
Data/Datum/Date/Date/Fecha	<input type="text"/>			Data/Datum/Date/Date/Fecha	<input type="text"/>		
Data riparazione/Reparaturdatum Repair Data/Date de réparation Fecha reparación	<input type="text"/>			Data riparazione/Reparaturdatum Repair Data/Date de réparation Fecha reparación	<input type="text"/>		
Eseguito dal Concessionario / Ausgeführt von der Vertragswerkstatt / Done by the Dealer Effectué par le concessionnaire / Efectuado por el Concesionario				Eseguito dal Concessionario / Ausgeführt von der Vertragswerkstatt / Done by the Dealer Effectué par le concessionnaire / Efectuado por el Concesionario			
Firma / Unterschrift / Signature / Signature / Firma				Firma / Unterschrift / Signature / Signature / Firma			
Service/Service Servizio	<input type="checkbox"/>	Richiamo/Rückruf Recall/Rappel Llamada a Taller	<input type="checkbox"/>	Service/Service Servizio	<input type="checkbox"/>	Richiamo/Rückruf Recall/Rappel Llamada a Taller	<input type="checkbox"/>
Numero/Nummer Número	<input type="text"/>			Numero/Nummer Número	<input type="text"/>		
Data/Datum/Date/Date/Fecha	<input type="text"/>			Data/Datum/Date/Date/Fecha	<input type="text"/>		
Data riparazione/Reparaturdatum Repair Data/Date de réparation Fecha reparación	<input type="text"/>			Data riparazione/Reparaturdatum Repair Data/Date de réparation Fecha reparación	<input type="text"/>		
Eseguito dal Concessionario / Ausgeführt von der Vertragswerkstatt / Done by the Dealer Effectué par le concessionnaire / Efectuado por el Concesionario				Eseguito dal Concessionario / Ausgeführt von der Vertragswerkstatt / Done by the Dealer Effectué par le concessionnaire / Efectuado por el Concesionario			

The information and procedures published below are strictly confidential and intended exclusively for authorized operators and individuals. All copyrights are the property of Automobili Lamborghini S.p.A based on copyright law. The company reserves the right to make updates and modifications. The reprinting, reproduction, forwarding to unauthorized people and/or to third parties and partial or entire translation thereof are prohibited without written authorization from Automobili Lamborghini S.p.A.




## Workshop instructions




### Preliminary operations:

1	Please be sure to have installed the VAS-PC Lamborghini version 18.41 and the Lamborghini Flash Container version 1.01 as described in the campaign nr L834-A.02.11:door module software update.
2	Help documentation: Aventador LP700-4 MY12 repair manual <ul style="list-style-type: none"><li>- chapter 10.92.00</li><li>- chapter 10.01.00</li><li>- chapter 10.02.00</li></ul>
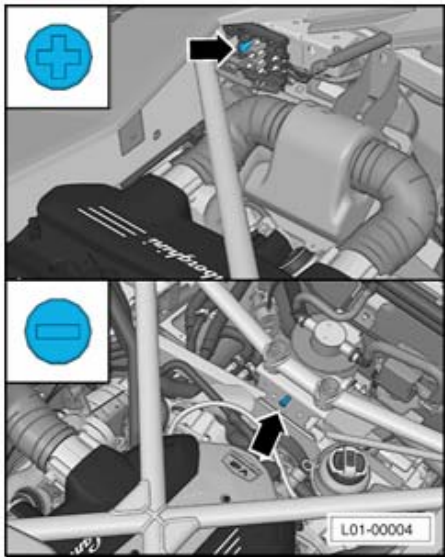
### Update procedure:



1	Please connect a battery charger to the recharge points in the engine bonnet, as shown in the picture beside.	
---	---	---

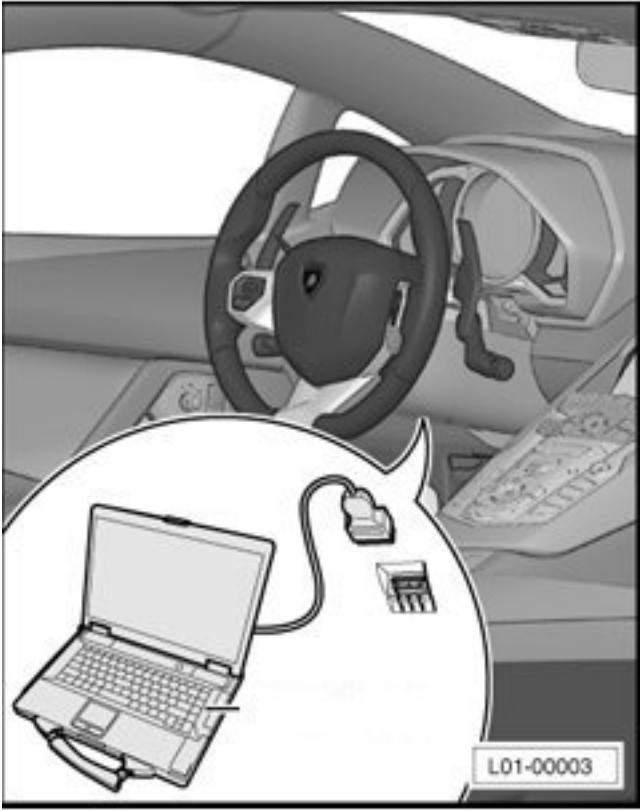*The information and procedures published below are strictly confidential and intended exclusively for authorized operators and individuals. All copyrights are the property of Automobili Lamborghini S.p.A based on copyright law. The company reserves the right to make updates and modifications. The reprinting, reproduction, forwarding to unauthorized people and/or to third parties and partial or entire translation thereof are prohibited without written authorization from Automobili Lamborghini S.p.A.*

<p><b>2</b></p>	<p>Please connect the VAS5054 interface to the vehicle's OBD plug and to the diagnostic laptop.</p> <p>Turn the ignition ON.</p>	
<p><b>3</b></p>	<p>Start the VAS-PC double clicking on the related icon on the desktop.</p>	
<p><b>4</b></p>	<p>Ignore the message about the base-CD update. Click on "OK".</p>	


*The information and procedures published below are strictly confidential and intended exclusively for authorized operators and individuals. All copyrights are the property of Automobili Lamborghini S.p.A based on copyright law. The company reserves the right to make updates and modifications. The reprinting, reproduction, forwarding to unauthorized people and/or to third parties and partial or entire translation thereof are prohibited without written authorization from Automobili Lamborghini S.p.A.*

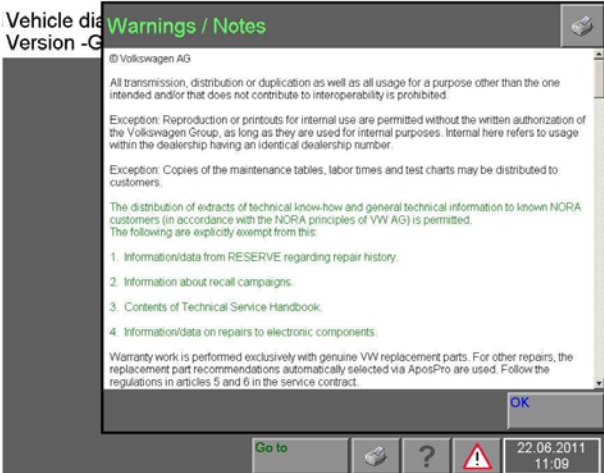

5	Click on “OK” to hide the general information window.	<p><b>VAS PC</b> Vehicle diagnostic, measuring and information system Version -GB- / V18.01.01 12/08/2010</p> 
6	Select “Guided Functions”.	<p><b>VAS PC</b> Vehicle diagnostic, measuring and information system Version -GB- / V18.01.01 12/08/2010</p> 



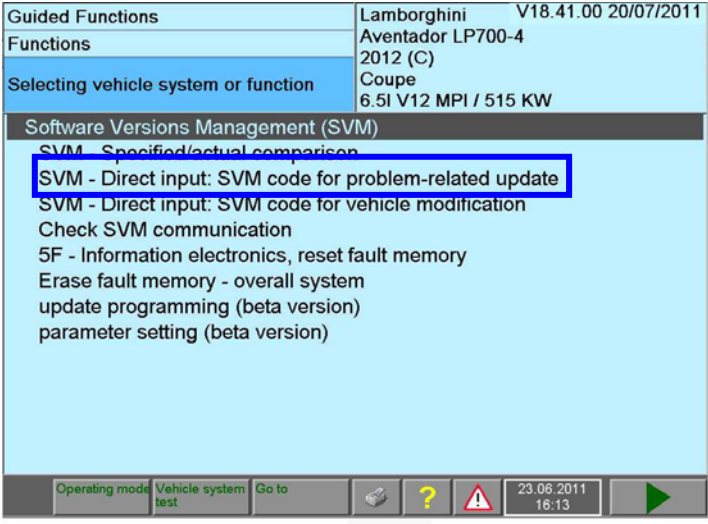
*The information and procedures published below are strictly confidential and intended exclusively for authorized operators and individuals. All copyrights are the property of Automobili Lamborghini S.p.A based on copyright law. The company reserves the right to make updates and modifications. The reprinting, reproduction, forwarding to unauthorized people and/or to third parties and partial or entire translation thereof are prohibited without written authorization from Automobili Lamborghini S.p.A.*



7	Click on "OK".	
8	Click on "Lamborghini".	
9	Confirm the vehicle identification data shown on the upper right clicking on  .	<p>Press "▶" button to confirm that the vehicle identification was performed correctly</p> <p>Press "◀" button to go back step by step.</p> <p>The "Go to" button and the "Cancel" selection lead to the "Select brand" screen.</p> <p>The "Go to" button and the "End" selection lead to the Start screen.</p>

The information and procedures published below are strictly confidential and intended exclusively for authorized operators and individuals. All copyrights are the property of Automobili Lamborghini S.p.A based on copyright law. The company reserves the right to make updates and modifications. The reprinting, reproduction, forwarding to unauthorized people and/or to third parties and partial or entire translation thereof are prohibited without written authorization from Automobili Lamborghini S.p.A.


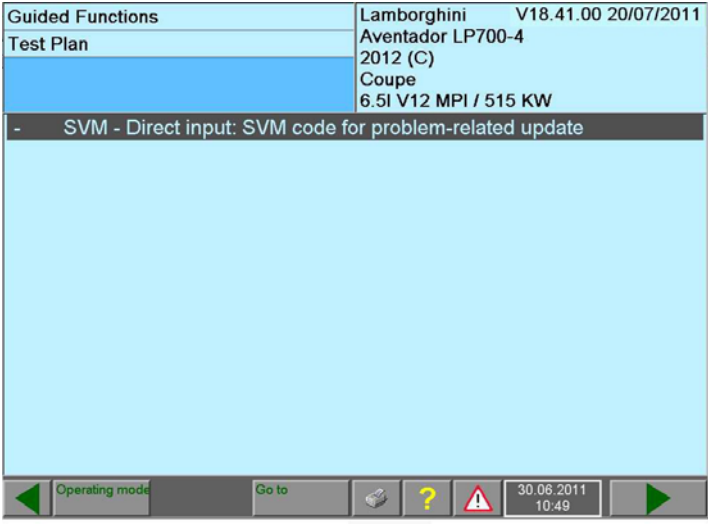
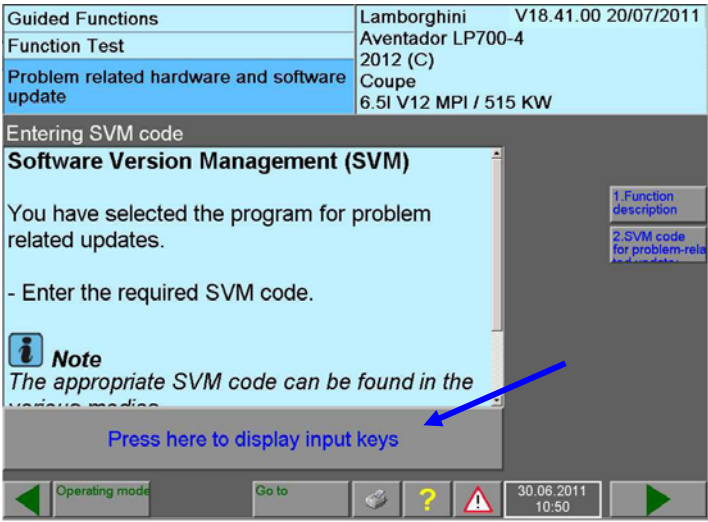

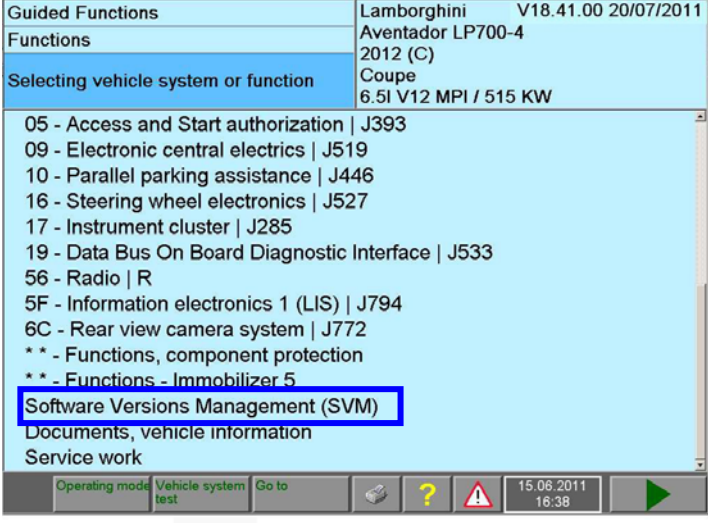
<p><b>10</b></p>	<p>Scroll down the ECU list and select “Software Version Management”.</p>	 <p>The screenshot shows the 'Guided Functions' menu with a list of vehicle systems. The 'Software Versions Management (SVM)' option is highlighted with a blue box. The interface also displays vehicle information: Lamborghini V18.41.00 20/07/2011, Aventador LP700-4, 2012 (C), Coupe, 6.5l V12 MPI / 515 KW. The bottom status bar shows 'Operating mode: Vehicle system test', 'Go to', and a date/time of 15.08.2011 16:38.</p>
<p><b>11</b></p>	<p>Select “SVM – Direct input: SVM code for problem related update” and click on  to add the program into the test plan.</p>	 <p>The screenshot shows the 'Software Versions Management (SVM)' menu. The option 'SVM - Direct input: SVM code for problem-related update' is highlighted with a blue box. The interface also displays the same vehicle information as the previous screenshot. The bottom status bar shows 'Operating mode: Vehicle system test', 'Go to', and a date/time of 23.08.2011 16:13.</p>

The information and procedures published below are strictly confidential and intended exclusively for authorized operators and individuals. All copyrights are the property of Automobili Lamborghini S.p.A based on copyright law. The company reserves the right to make updates and modifications. The reprinting, reproduction, forwarding to unauthorized people and/or to third parties and partial or entire translation thereof are prohibited without written authorization from Automobili Lamborghini S.p.A.








<p>12</p>	<p>Run the program clicking on .</p>	
<p>13</p>	<p>Click on the grey bar to enter the SVM code.</p>	

*The information and procedures published below are strictly confidential and intended exclusively for authorized operators and individuals. All copyrights are the property of Automobili Lamborghini S.p.A based on copyright law. The company reserves the right to make updates and modifications. The reprinting, reproduction, forwarding to unauthorized people and/or to third parties and partial or entire translation thereof are prohibited without written authorization from Automobili Lamborghini S.p.A.*





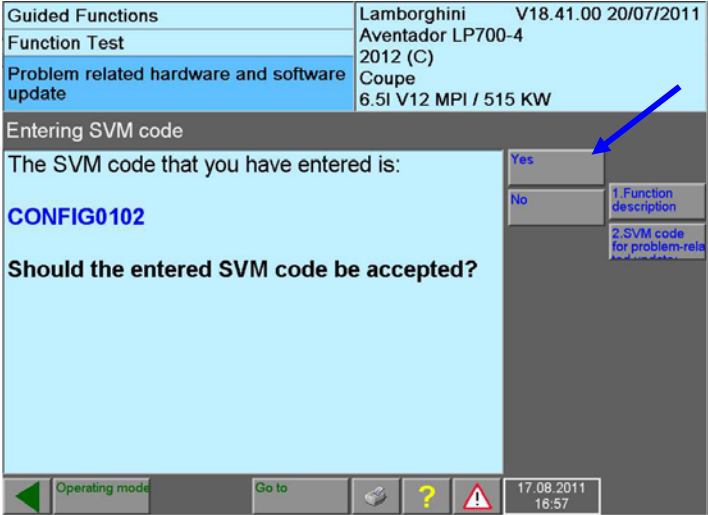

<p><b>14</b></p>	<p>Enter the code <b>CONFIG0102</b> then click on  to confirm.</p>	
<p><b>15</b></p>	<p>Confirm that the inserted code is correct clicking on “Yes”.</p>	



*The information and procedures published below are strictly confidential and intended exclusively for authorized operators and individuals. All copyrights are the property of Automobili Lamborghini S.p.A based on copyright law. The company reserves the right to make updates and modifications. The reprinting, reproduction, forwarding to unauthorized people and/or to third parties and partial or entire translation thereof are prohibited without written authorization from Automobili Lamborghini S.p.A.*

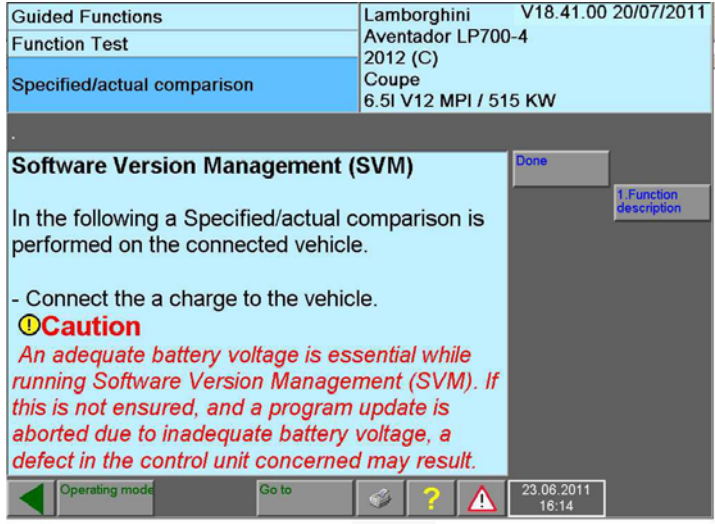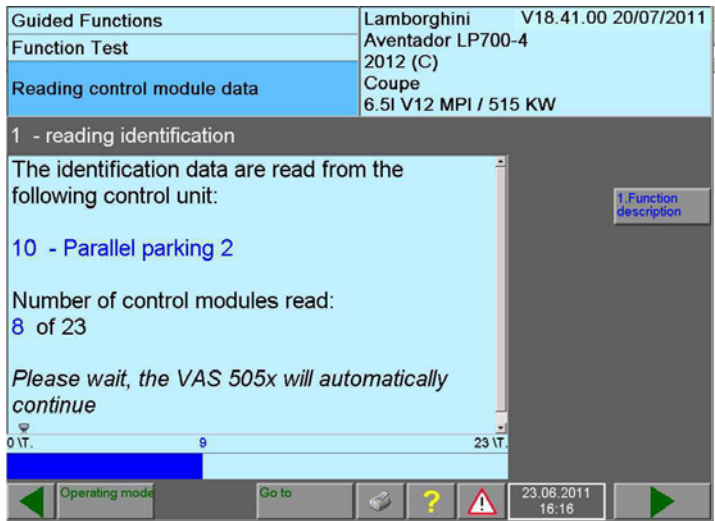

<p><b>16</b></p>	<p>Click on “Done” to start the data acquisition from all the vehicle’s ECUs.</p>	
<p><b>17</b></p>	<p>Wait until the data acquisition from all control modules is completed.</p>	



The information and procedures published below are strictly confidential and intended exclusively for authorized operators and individuals. All copyrights are the property of Automobili Lamborghini S.p.A based on copyright law. The company reserves the right to make updates and modifications. The reprinting, reproduction, forwarding to unauthorized people and/or to third parties and partial or entire translation thereof are prohibited without written authorization from Automobili Lamborghini S.p.A.

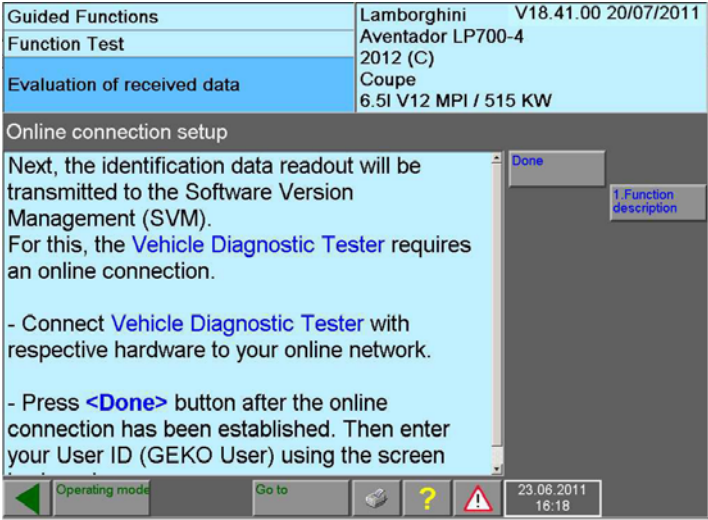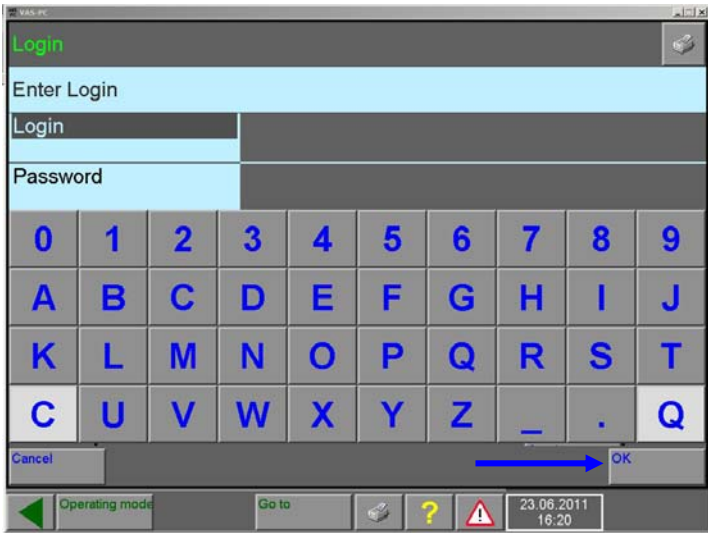

18	<p>For the online authentication a valid GeKo account is necessary. <u>Be sure that your internet connection is working properly.</u> Click on “Done” to access the Login window.</p>	
19	<p>Insert your GeKo user name in the field “Login” and the pin 1324 + current 6 digit code displayed on your GeKo token in the field Password. Then confirm clicking on OK.</p>	

*The information and procedures published below are strictly confidential and intended exclusively for authorized operators and individuals. All copyrights are the property of Automobili Lamborghini S.p.A based on copyright law. The company reserves the right to make updates and modifications. The reprinting, reproduction, forwarding to unauthorized people and/or to third parties and partial or entire translation thereof are prohibited without written authorization from Automobili Lamborghini S.p.A.*

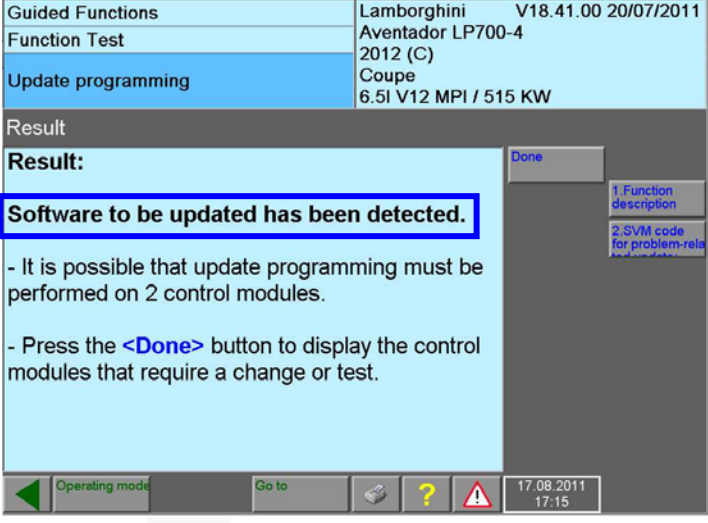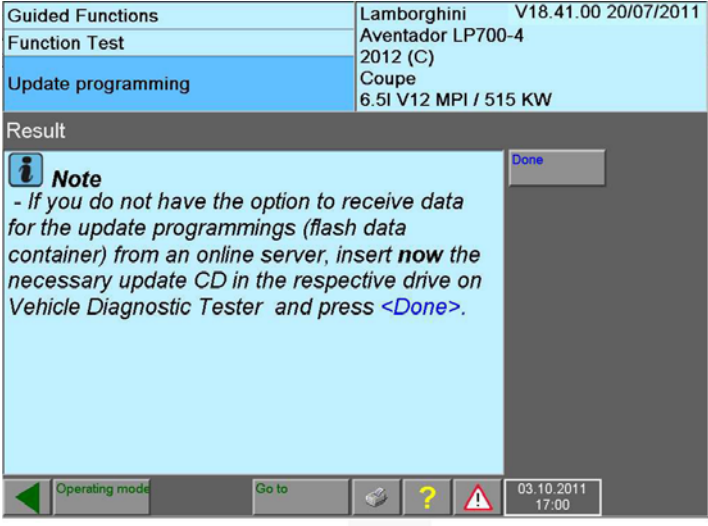

20	A message as shown beside informs you that a software to be updated has been detected". Click on "Done".	
21	The flash data containers are already saved on the diagnostic laptop. Press "Done".	



The information and procedures published below are strictly confidential and intended exclusively for authorized operators and individuals. All copyrights are the property of Automobili Lamborghini S.p.A based on copyright law. The company reserves the right to make updates and modifications. The reprinting, reproduction, forwarding to unauthorized people and/or to third parties and partial or entire translation thereof are prohibited without written authorization from Automobili Lamborghini S.p.A.



22	Press "Done".	
23	Click on "Done".	

The information and procedures published below are strictly confidential and intended exclusively for authorized operators and individuals. All copyrights are the property of Automobili Lamborghini S.p.A based on copyright law. The company reserves the right to make updates and modifications. The reprinting, reproduction, forwarding to unauthorized people and/or to third parties and partial or entire translation thereof are prohibited without written authorization from Automobili Lamborghini S.p.A.

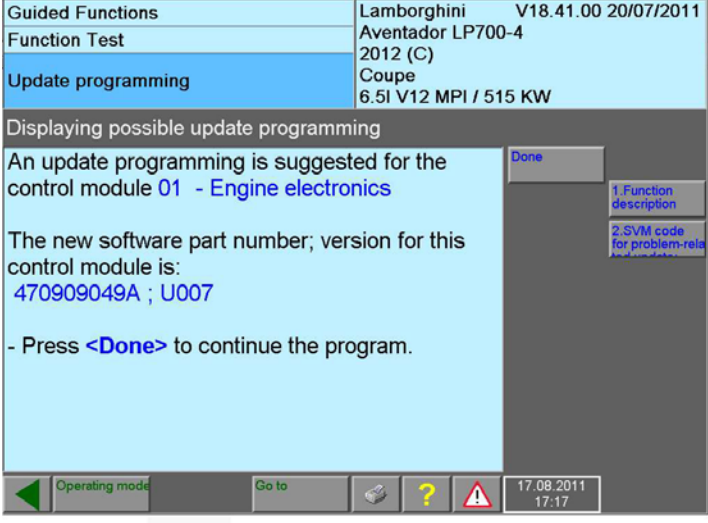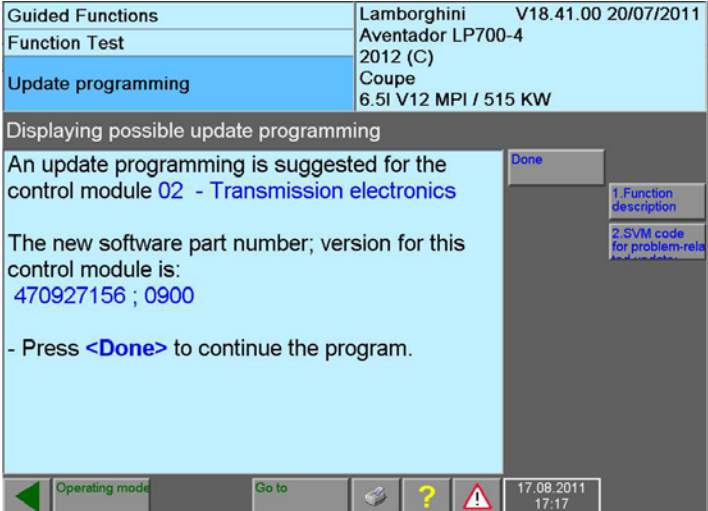

24	<p>Depending on the market, the new engine software part number and version will be <b>470909049A; U007</b> or <b>470909049B; V007</b></p> <p>Click on “Done”.</p>	
25	<p>The new gearbox software part number and version will be <b>470927156; 0900</b></p> <p>Press “Done” to continue.</p>	

The information and procedures published below are strictly confidential and intended exclusively for authorized operators and individuals. All copyrights are the property of Automobili Lamborghini S.p.A based on copyright law. The company reserves the right to make updates and modifications. The reprinting, reproduction, forwarding to unauthorized people and/or to third parties and partial or entire translation thereof are prohibited without written authorization from Automobili Lamborghini S.p.A.







26	Select the option no.2 “Perform update programming on all control modules without interruption”.	<div> <div> <div>Guided Functions</div> <div>Function Test</div> <div>Update programming</div> </div> <div> <div>Lamborghini</div> <div>Aventador LP700-4</div> <div>2012 (C)</div> <div>Coupe</div> <div>6.5l V12 MPI / 515 KW</div> </div> <div>V18.41.00 20/07/2011</div> </div> <div> <div>Displaying possible update programming</div> <div>How should the previously listed update programmings be performed?</div> <div> <div>1. Offer selection to start each update programming manually.</div> <div>2. Perform update programming on all control modules without interruption.</div> </div> <div> <div>- 1.-</div> <div>- 2.-</div> <div>1. Function description</div> <div>2. SVM code for problem-rela</div> </div> <div> <div>Operating mode</div> <div>Go to</div> <div>?</div> <div>17.08.2011 17:18</div> </div> </div>
27	Click on “Done” to start the flash update for both ECUs.	<div> <div> <div>Guided Functions</div> <div>Function Test</div> <div>Update programming</div> </div> <div> <div>Lamborghini</div> <div>Aventador LP700-4</div> <div>2012 (C)</div> <div>Coupe</div> <div>6.5l V12 MPI / 515 KW</div> </div> <div>V18.41.00 20/07/2011</div> </div> <div> <div>Displaying possible update programming</div> <div>In the following all update programmings of the previously listed control modules will be performed without interruption.</div> <div>- Press &lt;Done&gt; button to start update programming.</div> <div> <div>Done</div> <div>1. Function description</div> <div>2. SVM code for problem-rela</div> </div> <div> <div>Operating mode</div> <div>Go to</div> <div>?</div> <div>17.08.2011 17:18</div> </div> </div>

The information and procedures published below are strictly confidential and intended exclusively for authorized operators and individuals. All copyrights are the property of Automobili Lamborghini S.p.A based on copyright law. The company reserves the right to make updates and modifications. The reprinting, reproduction, forwarding to unauthorized people and/or to third parties and partial or entire translation thereof are prohibited without written authorization from Automobili Lamborghini S.p.A.





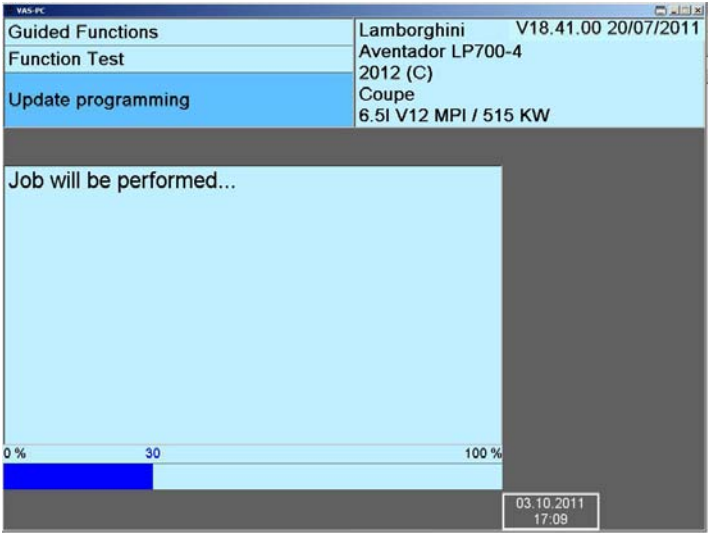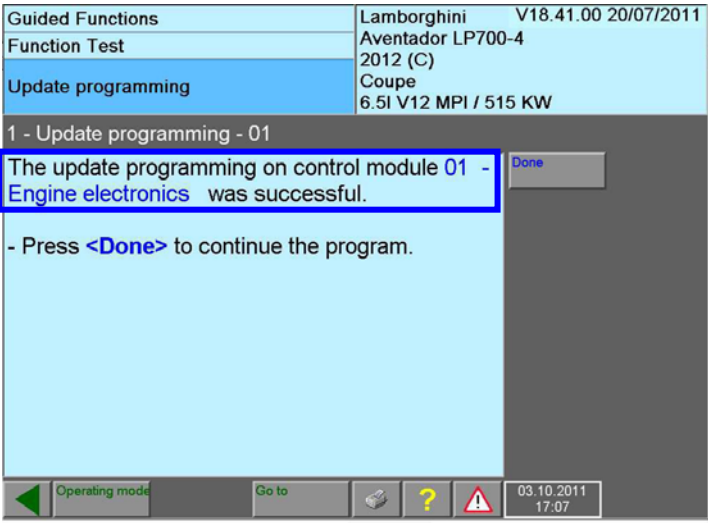

<p><b>28</b></p>	<p>Wait until the update programming of the engine ECU is completed.</p>	
<p><b>29</b></p>	<p>When the update is successful a confirmation message is displayed as shown in the picture. Press “Done” to start the update programming of the gearbox ECU.</p> <p>If the update programming has been incomplete or unsuccessful:</p> <ul style="list-style-type: none"> <li>- turn the ignition OFF</li> <li>- wait 1 minute before turning the ignition ON again</li> <li>- if offered by the program: select “Repeat” to retry the update programming, otherwise repeat the procedure from step 12</li> </ul>	

*The information and procedures published below are strictly confidential and intended exclusively for authorized operators and individuals. All copyrights are the property of Automobili Lamborghini S.p.A based on copyright law. The company reserves the right to make updates and modifications. The reprinting, reproduction, forwarding to unauthorized people and/or to third parties and partial or entire translation thereof are prohibited without written authorization from Automobili Lamborghini S.p.A.*

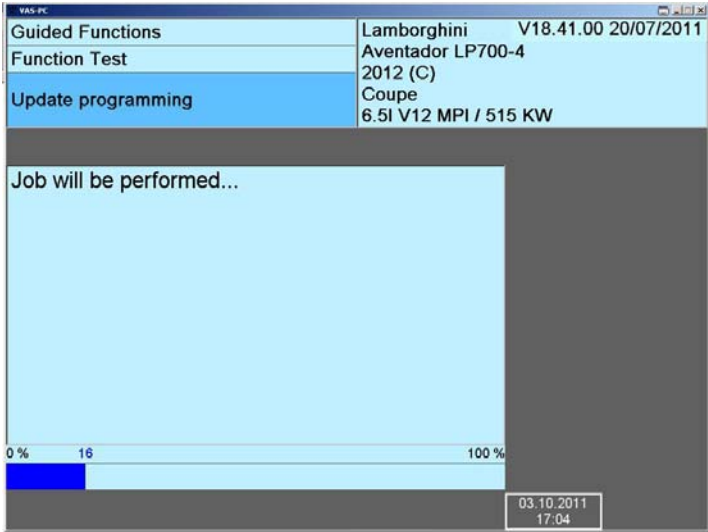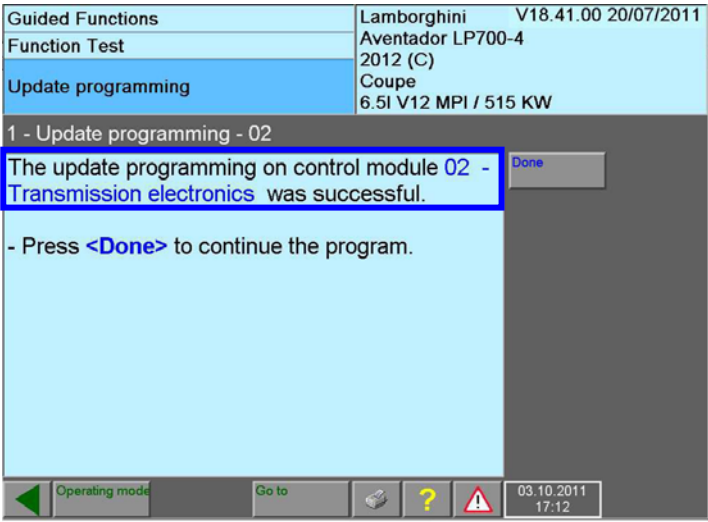

<p><b>30</b></p>	<p>Wait until the update programming of the gearbox ECU is completed.</p>	
<p><b>31</b></p>	<p>When the update is successful a confirmation message is displayed as shown in the picture. Press “Done” to continue.</p> <p>If the update programming has been incomplete or unsuccessful:</p> <ul style="list-style-type: none"> <li>- turn the ignition OFF</li> <li>- wait 1 minute before turning the ignition ON again</li> <li>- if offered by the program: select “Repeat” to retry the update programming, otherwise repeat the procedure from step 12</li> </ul>	


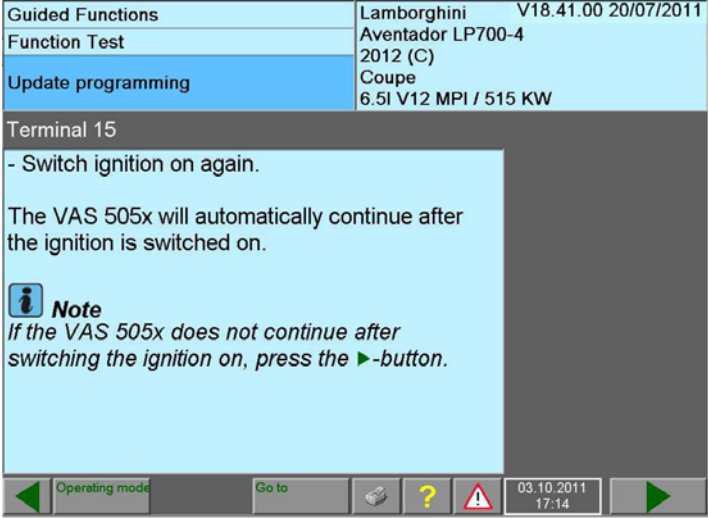
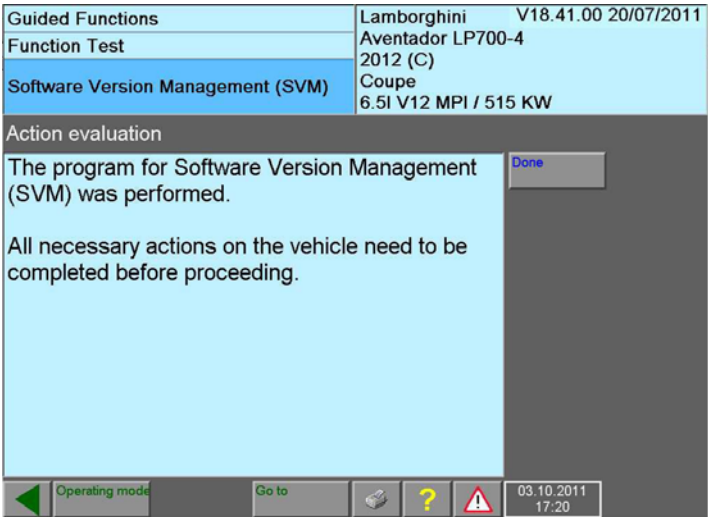
*The information and procedures published below are strictly confidential and intended exclusively for authorized operators and individuals. All copyrights are the property of Automobili Lamborghini S.p.A based on copyright law. The company reserves the right to make updates and modifications. The reprinting, reproduction, forwarding to unauthorized people and/or to third parties and partial or entire translation thereof are prohibited without written authorization from Automobili Lamborghini S.p.A.*



<p>32</p>	<p>In the following an ignition OFF – ON cycle is necessary to re-start both the ECU. Press “Done” to continue.</p>	
<p>33</p>	<p>Switch the ignition OFF.</p>	

*The information and procedures published below are strictly confidential and intended exclusively for authorized operators and individuals. All copyrights are the property of Automobili Lamborghini S.p.A based on copyright law. The company reserves the right to make updates and modifications. The reprinting, reproduction, forwarding to unauthorized people and/or to third parties and partial or entire translation thereof are prohibited without written authorization from Automobili Lamborghini S.p.A.*



<p>34</p>	<p><u>Wait 1 minute before switching the ignition ON again.</u></p> <p>Then press on .</p>	 <p>The screenshot shows the VAS 505x interface with the following content:</p> <ul style="list-style-type: none"> <li><b>Guided Functions</b>: Lamborghini V18.41.00 20/07/2011</li> <li><b>Function Test</b>: Aventador LP700-4</li> <li><b>Update programming</b>: 2012 (C) Coupe 6.5l V12 MPI / 515 KW</li> <li><b>Terminal 15</b>: - Switch ignition on again.</li> <li><b>Note</b>: The VAS 505x will automatically continue after the ignition is switched on.</li> <li><b>Note</b>: If the VAS 505x does not continue after switching the ignition on, press the ►-button.</li> <li><b>Buttons</b>: Operating mode, Go to, ? (Help), Warning, 03.10.2011 17:14, and a green right arrow button.</li> </ul>
<p>35</p>	<p>Press “Done”.</p>	 <p>The screenshot shows the VAS 505x interface with the following content:</p> <ul style="list-style-type: none"> <li><b>Guided Functions</b>: Lamborghini V18.41.00 20/07/2011</li> <li><b>Function Test</b>: Aventador LP700-4</li> <li><b>Software Version Management (SVM)</b>: 2012 (C) Coupe 6.5l V12 MPI / 515 KW</li> <li><b>Action evaluation</b>: The program for Software Version Management (SVM) was performed.</li> <li><b>Action evaluation</b>: All necessary actions on the vehicle need to be completed before proceeding.</li> <li><b>Buttons</b>: Operating mode, Go to, ? (Help), Warning, 03.10.2011 17:20, and a 'Done' button.</li> </ul>



The information and procedures published below are strictly confidential and intended exclusively for authorized operators and individuals. All copyrights are the property of Automobili Lamborghini S.p.A based on copyright law. The company reserves the right to make updates and modifications. The reprinting, reproduction, forwarding to unauthorized people and/or to third parties and partial or entire translation thereof are prohibited without written authorization from Automobili Lamborghini S.p.A.



36	Press “Done” to start the data report.	
37	Wait until the data acquisition from all the control modules is completed.	

*The information and procedures published below are strictly confidential and intended exclusively for authorized operators and individuals. All copyrights are the property of Automobili Lamborghini S.p.A based on copyright law. The company reserves the right to make updates and modifications. The reprinting, reproduction, forwarding to unauthorized people and/or to third parties and partial or entire translation thereof are prohibited without written authorization from Automobili Lamborghini S.p.A.*


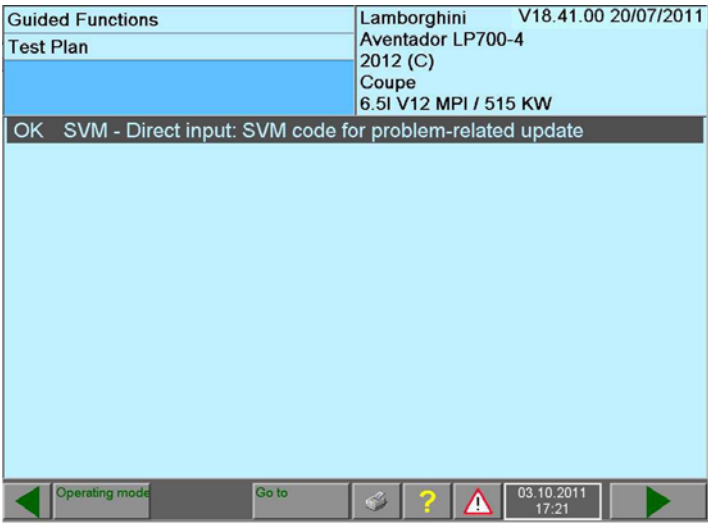
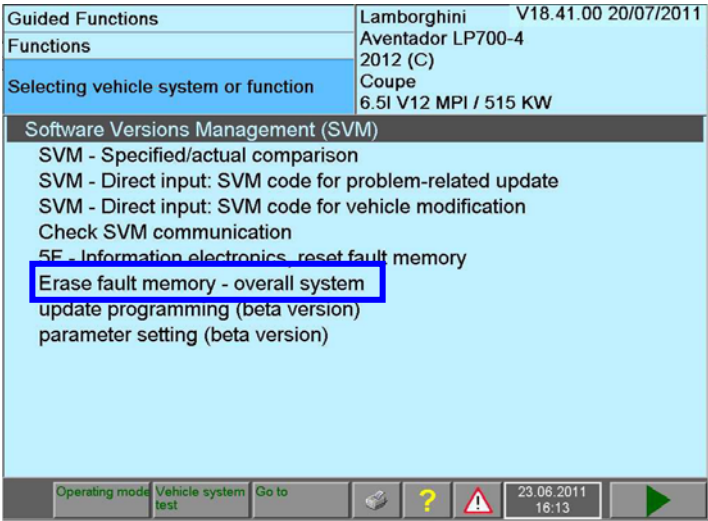

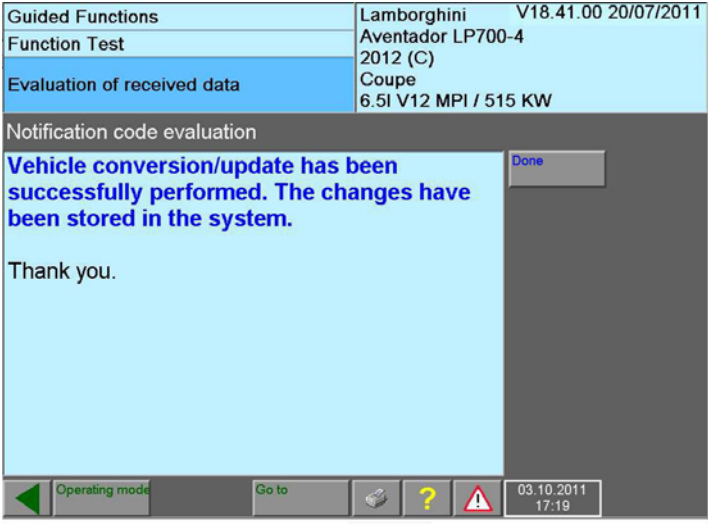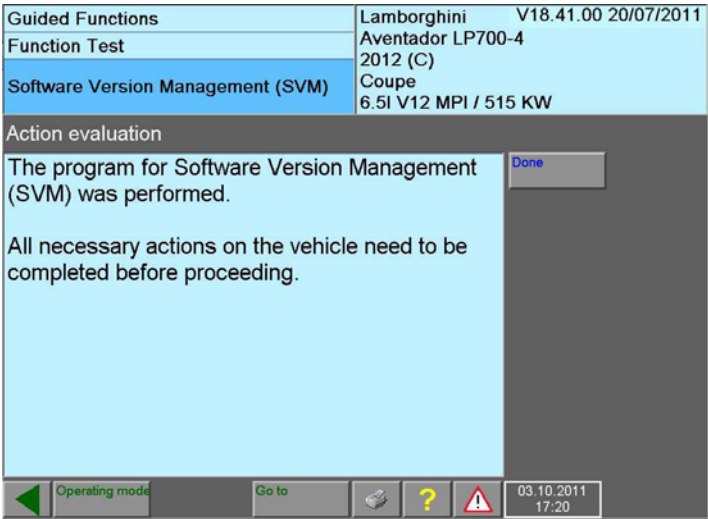
<p><b>38</b></p>	<p>The confirmation message shown in the pictures advises you that the update of engine and gearbox ECU has been completed. Press on “Done” and go on with the procedure.</p>	
<p><b>39</b></p>	<p>Press on “Done” to exit the program and go on with the procedure.</p>	

*The information and procedures published below are strictly confidential and intended exclusively for authorized operators and individuals. All copyrights are the property of Automobili Lamborghini S.p.A based on copyright law. The company reserves the right to make updates and modifications. The reprinting, reproduction, forwarding to unauthorized people and/or to third parties and partial or entire translation thereof are prohibited without written authorization from Automobili Lamborghini S.p.A.*





<p>40</p>	<p>Go back to the Software Version Management menu clicking on .</p>	
<p>41</p>	<p>Select and run the program “Erase fault memory – overall systems” to clear all the faults stored because of the software update.</p>	

The information and procedures published below are strictly confidential and intended exclusively for authorized operators and individuals. All copyrights are the property of Automobili Lamborghini S.p.A based on copyright law. The company reserves the right to make updates and modifications. The reprinting, reproduction, forwarding to unauthorized people and/or to third parties and partial or entire translation thereof are prohibited without written authorization from Automobili Lamborghini S.p.A.





## ECU adaptations after software programming



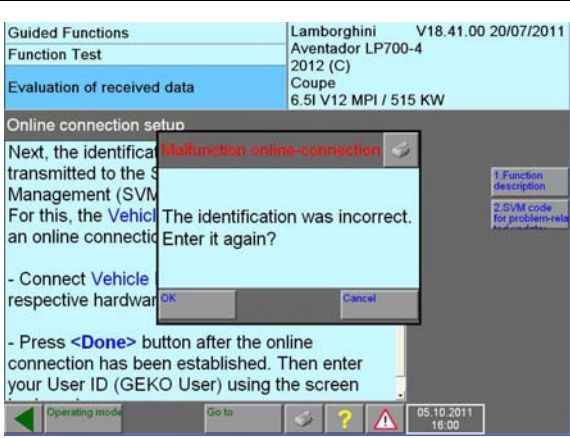
Please perform the following procedures to execute the correct adaptations of gearbox and engine ECU after the software programming

1	<p>In order to setup the Gearbox ECU: select 02 – Gearbox Electronics and run the program “02 – ECU setup after replacement / software programming”. See the repair manual at the chapter <b>10.02.00</b> for the related instructions</p>	<div><div><div>Guided Functions</div><div>Functions</div><div>Selecting vehicle system or function</div></div><div>Lamborghini V18.39.00 01/03/2011 LP700-4 MY12 &gt; 2012 (C) Coupe 6.5l V12 MPI / 515 KW</div></div> <div>02 - Transmission electronics   J217</div> <div>02 - Installation locations</div> <div>02 - Identification, (Main gr. 03)</div> <div>02 - DTC memory content, (Main gr. 03)</div> <div>02 - Output Diagnostic Test Modus, (Main gr. 03)</div> <div>02 - Measured values, (Main gr. 03)</div> <div>02 - Replace control module, (Main gr. 09, Subgr. 81)</div> <div>02 - Gear adaptation, (Main gr. 03)</div> <div>02 - Disable hydraulic pump</div> <div>02 - Bleed clutch/valves</div> <div>02 - Reset Clutch counter (clutch replacement)</div> <div>02 - ECU setup after replacement / software programming</div> <div><div>Operating mode</div><div>Vehicle system test</div><div>Go to</div><div></div><div></div><div></div><div>05.04.2011 16:55</div><div></div></div>
2	<p>Perform the Throttle valves self learning at idle. See the repair manual at the chapter <b>10.01.00</b> for the related procedure.</p>	

*The information and procedures published below are strictly confidential and intended exclusively for authorized operators and individuals. All copyrights are the property of Automobili Lamborghini S.p.A based on copyright law. The company reserves the right to make updates and modifications. The reprinting, reproduction, forwarding to unauthorized people and/or to third parties and partial or entire translation thereof are prohibited without written authorization from Automobili Lamborghini S.p.A.*



## Troubleshooting
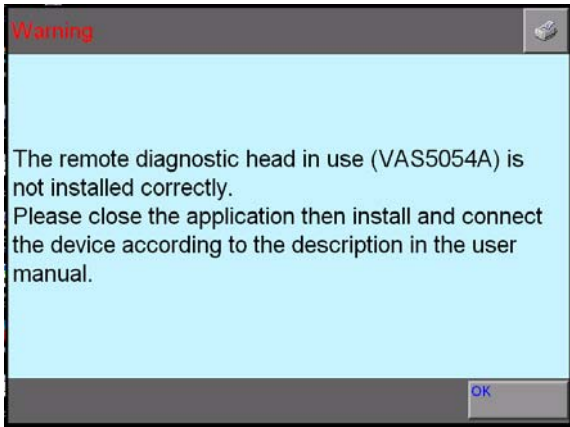
<p><b>A.</b></p>	<p>If the error message regarding the VAS5054 interface is shown as in the picture beside:</p> <ul style="list-style-type: none"> <li>- close the VAS-PC and repeat the VAS5054 installation as described in the chapter <b>10.92.00</b></li> </ul>	
<p><b>B.</b></p>	<p>If the connection error screen is shown as in the picture beside:</p> <ul style="list-style-type: none"> <li>- it is not possible to establish a connection with the central server. Please check carefully that the diagnosis laptop is properly connected to the internet network</li> </ul>	
<p><b>C.</b></p>	<p>If the incorrect identification message is shown as in the picture beside:</p> <ul style="list-style-type: none"> <li>- be sure that your Geko account is valid;</li> <li>- be sure that the label “Geko” is written on the token that you are using for the authentication;</li> <li>- click on Cancel and perform the application test as described in the chapter <b>10.92.00</b>.</li> </ul>	

*The information and procedures published below are strictly confidential and intended exclusively for authorized operators and individuals. All copyrights are the property of Automobili Lamborghini S.p.A based on copyright law. The company reserves the right to make updates and modifications. The reprinting, reproduction, forwarding to unauthorized people and/or to third parties and partial or entire translation thereof are prohibited without written authorization from Automobili Lamborghini S.p.A.*



Your Area Manager is at full disposal for further information.

Best regards

Customer Service

---

*The information and procedures published below are strictly confidential and intended exclusively for authorized operators and individuals. All copyrights are the property of Automobili Lamborghini S.p.A based on copyright law. The company reserves the right to make updates and modifications. The reprinting, reproduction, forwarding to unauthorized people and/or to third parties and partial or entire translation thereof are prohibited without written authorization from Automobili Lamborghini S.p.A.*