WORK DESCRIPTION FOR FIELD MEASURE

Code: 21P3290203 **Version: 2.0**

Correct torque of screw connection between hydraulic lines and all suspension struts

Model 223

Work procedure

- 1. Lift vehicle with vehicle lift.
 - i For basic data, see AR00.60-P-1006A.
- 2. Correct torque of screw connection (A) between both hydraulic lines (B) and all suspension struts (C) on the **front and rear axles** (Figure 1).
 - i Screw connection torque between hydraulic line and suspension strut 27.

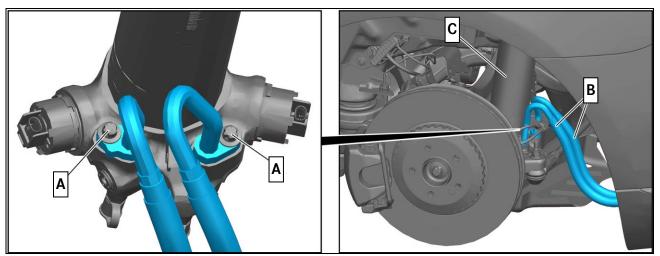


Figure 1

3. Assemble in reverse order.

Operation text and flat rate

Operation no.	Operation text	Flat rate	Accounting no./ damage code
02-0856	Correct torque of screw connection between hydraulic lines and 4 suspension struts	0.4 h	32 902 03

Mercedes-Benz Global Service & Parts