

Hellwig Helper Springs Adjustment

Bulletin Type:	SRP	Publication Date:	August 2026
Bulletin #(s):	26-021	Make(s):	Jayco & Entegra Coach
Job Code(s):	<i>**If affected unit has a warranty remaining, submit your claim following the normal process.</i>	Model(s):	Redhawk, Greyhawk, Odyssey
Flat Rate(s):		Model Year(s):	2026 - 2027

Incident:	Hellwig Helper Spring U-bolt is causing unusual noise.
Affected Units:	Certain 2026 - 2027 Jayco Greyhawk & Redhawk & Certain 2026 - 2027 Entegra Coach Odyssey
Parts Kit: N/A	Parts Kit #: N/A
	N/A
Misc. Tools & Supplies:	Pry Bar Tube or Wood
Parts Return Information:	N/A

HELLWIG HELPER SPRINGS ADJUSTMENT INSTRUCTION

1. Locate the U-Bolt and leaf springs at the rear axle of the coach.
2. Use a pry bar or metal bar with a sharpened point, insert it in the hole in the chassis frame rail next to the sway bar link and U-bolt, above the helper spring. (Figure 1)


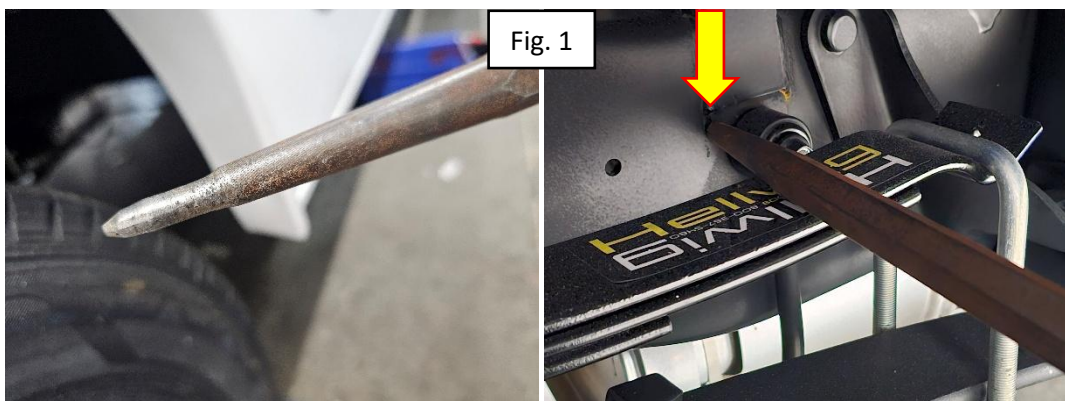


Fig. 1

3. Place the tube over the pry bar handle and use it for leverage to remove the pressure from the leaf springs.
 - a. **Note: You may also use a wood piece to use for leverage, if a tube is not available.** (Figure 2)
4. Adjust the U-bolt so it is over the **second** stack up on the springs. (Figure 3)

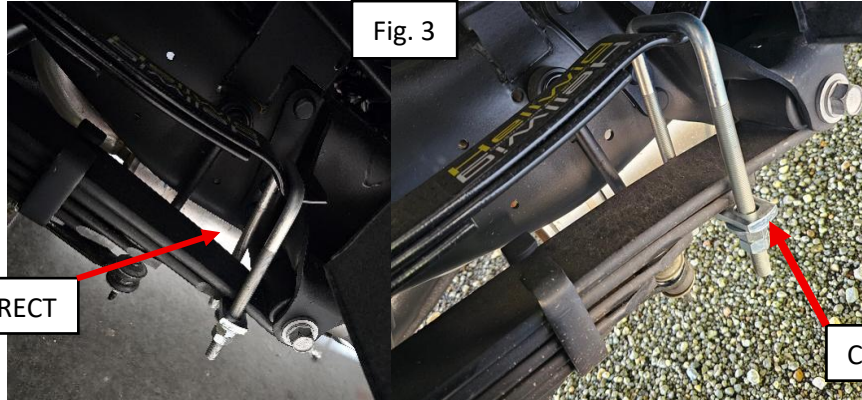

5. Release the pressure from the springs so they return to the original position.
6. Remove the pry bar.

Jayco's sole obligation under our limited warranty is to repair or replace defective materials and/or workmanship deemed our responsibility as determined by Jayco in our sole discretion. Jayco reserves the right to use new and/or remanufactured parts or materials of similar quality to complete any work, and to make parts and/or design changes as appropriate without notice to anyone. Jayco designs and/or materials changes are done without obligation to incorporate such changes in previously manufactured product. Jayco makes every reasonable effort to ensure field remedies will not adversely affect performance and/or safety of the unit. This field remedy is not intended to extend to future performance of this RV, or any of its materials, components or parts beyond the standard warranty period. The RV owner's obligation to notify Jayco, or one of its independent, authorized dealers, of a claimed defect does not modify any obligation placed on the RV owner to contact Jayco directly when attempting to pursue remedies under state or federal law.

903 South Main Street • P.O. Box 460 • Middlebury, IN 46540