



F53 Wire Harness and Brake Cable Securement

Bulletin Type:	Safety Recall	Publication Date:	January 2022
Bulletin #(s):	21V-997 US 2021-781 Canada	Make(s):	Jayco Entegra Coach
Job Code(s):	9903573A-Inspect Only 9903573B-Inspect and Secure Harness	Model(s):	Alante Class A Vision Class A
Flat Rate(s):	9903573A - 0.1 Hr. 9903573B - 0.25 Hr.	Model Year(s):	2022


Incident:	Wire harness not secured away from the exhaust manifold.
Affected Units:	2022 - Jayco Alante 2022 - Entegra Vision
Part Kit Number: 21V-997	Part Kit Contents : (1) Clamp, Vinyl Coat Stl Loop 2.50 (0201109) (1) SCREW,HEX WSHR .25X1.00 TEK3 ZC (0017714)
Misc. Tools & Supplies:	Screw Gun with 1/4" Hex Head Nut Driver Socket
Parts Return Information:	No parts to return

INSTRUCTIONS


- Using the forward jacks, lift the front of the unit until front tire is slightly off the ground.
(Fig. 1)



2. Locate chassis wire harness and brake cable which is not secured between the frame rail and engine. (Fig. 2)

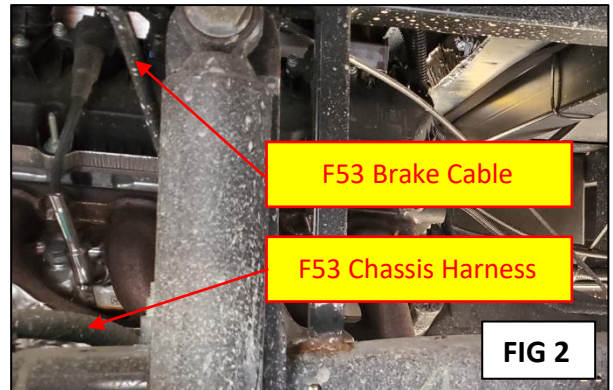

3. Using loop clamp and TEK Screw, secure both the wire harness and brake cable to the vertical tube. (Fig. 3)
4. If the wire harness has the plastic securement clip, re-install in the top of the frame rail. (Fig. 3)
5. Raise the forward jacks.

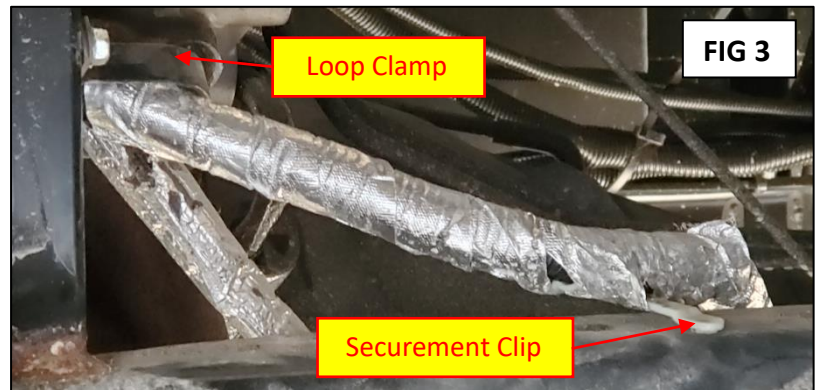

Jayco's sole obligation under our limited warranty is to repair or replace defective materials and/or workmanship deemed our responsibility as determined by Jayco in our sole discretion. Jayco reserves the right to use new and/or remanufactured parts or materials of similar quality to complete any work, and to make parts and/or design changes as appropriate without notice to anyone. Jayco designs and/or materials changes are done without obligation to incorporate such changes in previously manufactured product. Jayco makes every reasonable effort to ensure field remedies will not adversely affect performance and/or safety of the unit. This field remedy is not intended to extend to future performance of this RV, or any of its materials, components or parts beyond the standard warranty period. The RV owner's obligation to notify Jayco, or one of its independent, authorized dealers, of a claimed defect does not modify any obligation placed on the RV owner to contact Jayco directly when attempting to pursue remedies under state or federal law. Jan. 2019.

903 South Main Street • P.O. Box 460 • Middlebury, IN 46540