



## INSTRUCTIONS TO PERFORM RECALL CAMPAIGN 167

---

### Models Affected:

Certain Model Year Winnebago Certain 2021-2022 Inspire (Y34AE) Motorhomes.  
These motorhomes were manufactured from May 17, 2021, through November 23, 2021.

### Tools Required:

- Screw gun
- Tape measure
- Silicone

### Procedure:

1. Remove screws that attach the two  $\frac{3}{4}$ " step supports. Discard screws and step support sticks




2. Using silicone fill the open screw holes left after removing the  $\frac{3}{4}$ " step support sticks.
3. Open recall kit RC7652-22-767 containing 2 - 1  $\frac{1}{2}$ " support sticks and the 6 fasteners.



4. Locate the 1 ½” support sticks from the kit, 2 ¼” from the top of the floor ( see photo below). Ensure the chamfer edge of stick points towards the door opening.



5. Use the fasteners provided in kit and screw it in place. Repeat procedure for the other side.
6. After installation ensure the step overlaps the support sticks (see photo below)

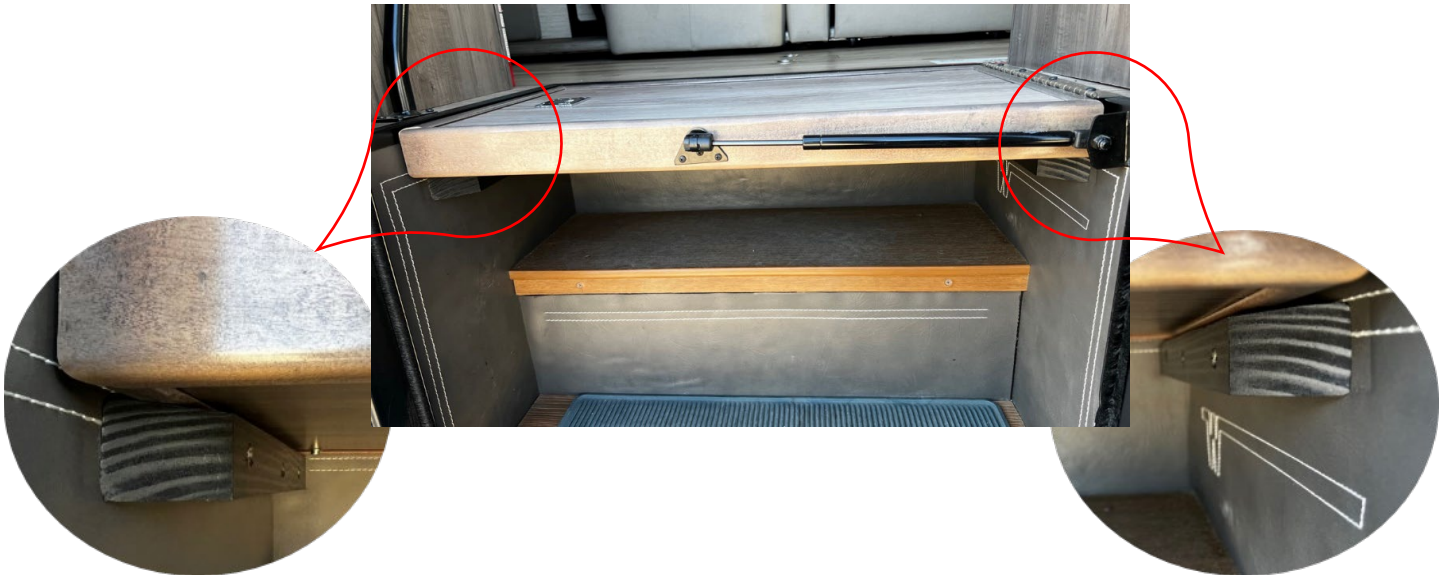

7. Complete warranty reimbursement claim and send in.