

ToAll Lamborghini Dealers and Licensed Service PointsFromCustomer Service DepartmentSubjectReplacement of the front luggage lamp housingGroup824.8.63Date18.11.2008Pages4

Subject

Replacement of the front luggage lamp housing.

Automobili Lamborghini S.p.A.

Model

All Murcileago Coupè and Roadster MY 09 as indicated below:

ZHWBE37S09LA03286
ZHWBE47S09LA03292
ZHWBE37S09LA03318
ZHWBE37S09LA03328

Information to the field

Due to a detective component of the front luggage lamp housing, it is possible the battery could become discharged.

Field solution

Follow the workshop instructions in this document for the replacement of the front luggage lamp housing.

Spare Parts

Following the list of spare parts necessary per each vehicle, p/n 3B0947415B.

All the parts changed must to be scraped.

Via Modena,12 I-40019 Sant'Agata Bolognese Tel +39 051 6817 652 Fax +39 051-6817 709



Warranty Claim data

The warranty reimbursement request for this rework action will be managed by the following standard Warranty Claim procedures.

Campaign Code:	L824-A.05.08
	L825-A.05.08
Campaign Description:	Replacement of the front luggage lamp housing
Cost Code:	50
Component Code:	CCA0508
Trouble Code:	220
Labour Code:	CCA0508100
Labour Time:	0,25 h


Remember to fill all data in the section "Service and Recall Campaign" in the Warranty booklet of the vehicle as shown below.

Automobili Lamborghini S.p.A. Campagne service assistenza e campagne di richiamo / Service-und Rückrufaktion / Service and Recall Campaign Service et campagne de rappel / Campaña de Servicio y Llamada a Taller		
Service/Service Richlamo/Rückruf Service/Service Lamada a faller	Service/Service Ricci/Racpai Service/Service Liamoda a failer	
Numero/Nummer Number/Numero Numero	Numero/Numero Number/Numero Numero	
Data/Datum/Date/Date/Fecha	Data/Datum/Date/Date/Fecha	
Data riparazione/Reparaturdatum Repairi Data/Date de réparation Pecha reparación	Data roanzične (Reparatur datum Repair Data/Date de reparation Fecha reparación	
Firma / Unterschrift / Signature / Signature / Firma	Firma / Unterschrift / Signature / Signature / Firma	
Firma / Unterschrift / Signature / Signature / Firma	Firma / Unterschrift / Signature / Signature / Firma	
Service/Service Richiamo/Rickruf Service/Service Recall/Rappel Servicio	Service/Service Rebans/Richard	
Numero/Nummero	Numero/Nummer Numer/Numero	
Deta/Dotum/Date/Fecha	Deta/Datum/Date/Dete/Fecha	
Dass insuracione/Reparaturdaturn Resear Otationida do réparation recha reparación	Data riparatione/Reparaturdatum Control Contro	
Esequito dal Concessionario / Ausgeführt von der Vertragswerkstatt / Done by the Dealer	Eseguito dal Concessionario / Ausgeführt von der Vertragswerkstatt / Done by the Dealer	




Workshop instructions

- **1.1** Please observe all safety precautions in order to prevent personal injury or damage to the vehicle.
- **1.2** Pull out the lamp housing of the front luggage (1-Pict.1) of the vehicle.

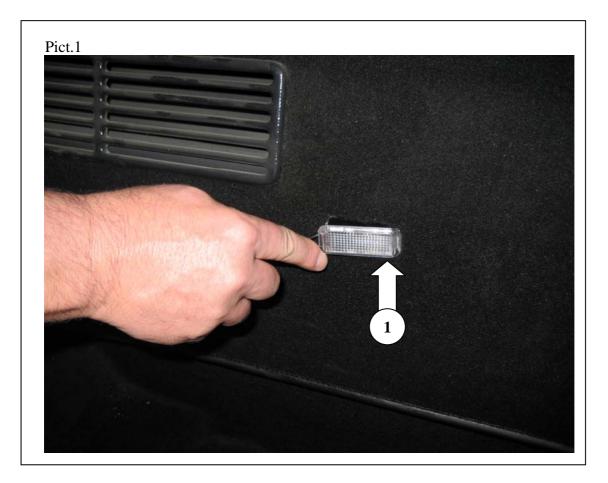



1.3 Disconnect the connector (1-Pict.2) of the front luggage lamp from its housing.

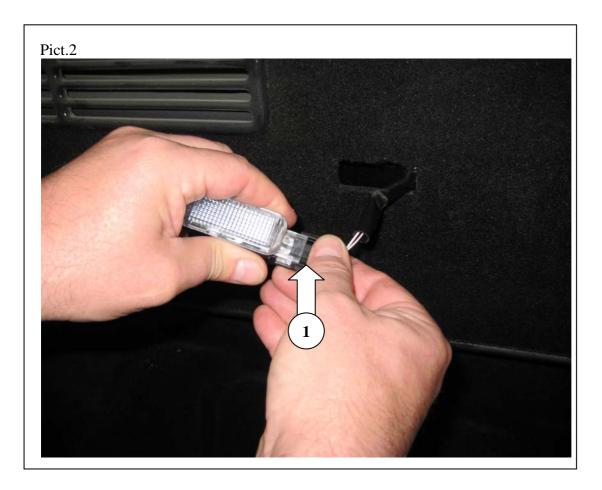

1.4 Replace the old lamp housing (1-Pict.1) with the new lamp housing (p/n 3B0947415B).

Your Area Manager is at full disposal for further information.

Best regards

Customer Service